

Work Order ID 149728

Wednesday, July 27, 2016 11:00:37 AM

149728

Page 1

Item ID: D212-664-201TRN

Accept

N9000040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 7/27/2016 *9/6* Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 8/10/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan:

DAS

21

9-89

Date: JUL 27 2016 Pooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D212-664-241

Rev E

100

0.05

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.16

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA114

2-Turn first side as per Folio FA114

3-Blend transition lines only. **do not sand whole tube**;

FOLIO REV: *AA*DWG REV: *E*

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

DAS
23
9-89

17/3/9

110

QC1- Inspection performed by CMM

0.00

110

QC

Memo

0.00

Quality Control

DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
DART									
							Completed By Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐		☐	Pressure/Forced	☐	Temperature/Cure
Design ☐	☐	Operator ☐		☐	Bending	☐	Set-up
Doc/Data ☐	☐	Offset/Setup ☐		☐	Centre Not Concentric	☐	BOM/Route
Equip/Tooling ☐	☐	Supplier ☐		☐	Cracks	☐	Broken/Damage/Defect
Handling/Pre ☐	☐	Training ☐		☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified
Material ☐	☐	Use for Testing ☐		☐	Cuffs	☐	Contamination
Internal Transport ☐	☐	Poor Information ☐		☐	Crushing	☐	Countersink
Tribal Knowledge ☐	☐	Rushing ☐		☐	Heat Treat	☐	Cut Too Short
LOA ☐	☐	Product Improvement ☐		☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear
Substation ☐	☐	Process Improvement ☐		☐	Marks/Chatter	☐	Drill Holes
Past Expiry Date ☐	☐	Manufacturing Process ☐		OTHER : _____			
Misidentified ☐	☐	Past Due ☐					

Wednesday, July 27, 2016 11:00:37 AM

Page 2

**DAS
23
9-89**

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By _____		
							Lead hand / Supervisor Approval Verification _____		
							QC / QA Coordinator Approval _____		

Root Cause				FAULT CATEGORY			
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
				Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
				Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
				Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
				Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
				Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
				Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
				Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
				OTHER : _____			

Work Order ID 149728

Wednesday, July 27, 2016 11:00:37 AM

149728

Page 3

Item ID: D212-664-201TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 7/27/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/10/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

17-03-14

DAS
47
9-89

145

0.00

145

Crosstubes

Memo

0.10

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

TW 17-03-20

150

0.00

150

HandFXtube

Memo

0.09

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED
SCOTCH BRITE

(X)

2017/03/29
BEB

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

Work Order ID 149728

Wednesday, July 27, 2016 11:00:37 AM

149728

Page 4

Item ID: D212-664-201TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 7/27/2016 Start Qty: 1.00 ***1***Required Date: 8/10/2016 Req'd Qty: 1.00 ***1***

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC7-Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.00							
Quality Control									
170	Packaging	0.00							
170									
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack Location: <u>LG14</u>								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.02							
Quality Control									

17-03-30

DAS
37
9-89

17-03-30

DAS
37
9-89

17/4/3

DAS
21
9-89

MAR 30 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
2AC TE 3B-6																																																																	
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Wednesday, July 27, 2016 11:00:46 AM

Page 1

Work Order ID: 149728

149728

Parent Item: D212-664-201TRN

D212-664-201TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 7/27/2016

Required Date: 8/10/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6006-129		Manufactured	No			120	Each	72.0000	1	1			
**													

D6006-129

Crosstube Material

Location	Loc Qty	Loc Code
LG003	37	
107875	14	
107876	2	
123969	21	
SHED	35	
123967	18	
139422	17	

1

17/3/7

DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause		FAULT CATEGORY									
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :							
Misidentified	☐	Past Due	☐								


DART AEROSPACE LTD	Work Order:	149728
Description: Crosstube Assembly (205/212 High Aft)	Part Number:	D212-664-241
Inspection Dwg: D212-664-241 Rev: E		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	0.200	✓		↑	
	R0.063	+/-0.010	R0.063	✓			
	2.990	+0.005/-0.000	2.992	✓		Vernier	
	5.237	+/-0.030	5.237	✓		tape	
	2.600	+0.005/-0.000	2.603	✓		↑	
	2.686	+0.005/-0.000	2.688	✓			
	2.770	+0.005/-0.000	2.773	✓			
	2.854	+0.005/-0.000	2.257	✓			
	2.938	+0.005/-0.000	2.941	✓			
	3.021	+0.005/-0.000	3.024	✓			
	3.133	+0.005/-0.000	3.135	✓			
	3.179	+0.005/-0.000	3.182	✓		Vernier	
SIDE B	0.200	+/-0.010	0.200	✓		↑	
	R0.063	+/-0.010	R0.063	✓			
	2.990	+0.005/-0.000	2.992	✓		Vernier	
	5.237	+/-0.030	5.237	✓		tape	
	2.600	+0.005/-0.000	2.607	✓		↑	
	2.686	+0.005/-0.000	2.690	✓			
	2.770	+0.005/-0.000	2.775	✓			
	2.854	+0.005/-0.000	2.858	✓			
	2.938	+0.005/-0.000	2.942	✓			
	3.021	+0.005/-0.000	3.024	✓			
	3.133	+0.005/-0.000	3.135	✓			
	3.179	+0.005/-0.000	3.182	✓		Vernier	
	124.362	+/-0.020	124.352	✓		tape	

DART AEROSPACE LTD	Work Order:	149728
Description: Crosstube Assembly (205/212 High Aft)	Part Number:	D212-664-241
Inspection Dwg: D212-664-241 Rev: E		Page 2 of 2

WALL THICKNESS MEASUREMENT

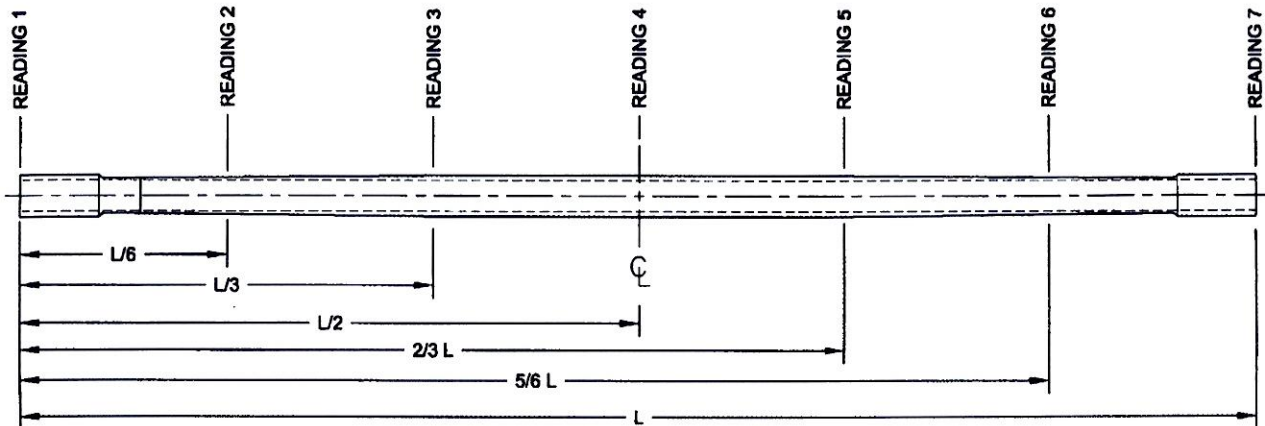

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	420	384	373	410	0.047	0.062"
READING 2 L= 20.727	334	307	296	323	0.038	
READING 3 L= 41.454	498	486	484	494	0.014	
READING 4 L= 62.181	522	514	515	527	0.013	
READING 5 L= 82.908	500	483	475	493	0.025	
READING 6 L= 103.635	345	313	290	316	0.055	
READING 7 L= 124.362	415	398	381	395	0.034	

Calibration Result

Actual Block Thickness: 250.500-750

Sitiescan 250 Measured Thickness: 250.750

Measured by:	DAS 23 9-89	Audited by:	DAS 47 9-89	Preliminary Approval:	
Date:	17/3/14	Date:	17-03-14	Date:	

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-201)	KJ/JLM	
B	06.03.09	Tolerance for 5.237 was +/-0.001	KJ/JLM	
C	07.05.08	Dwg Rev. updated	KJ/JLM	
D	10.08.03	Dimension 124.362 was 124.36	KJ	
E	12.06.04	Wall thickness form added	KJ	
F	15.03.03	Dwg Rev updated	KJ	

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2		D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6		2	D5018-1	SUPPORT
7	4	4	MS21920-28	CLAMP (OR MS21920-30)
8	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.382±0.020
- FINISH: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: D212-664-241/-241B = 44.2 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY


- INSTALL D2940-1 / D5018-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER


NO. 149728 MJS
1607-27

RELEASED
2014-05-26
MP

E	D5018-1 WAS D2940-1 (-241B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (ZN B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-4), INCOMP DEO D-1/2	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	9P		
DRAWN	9P		
CHECKED	DW		
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D212-664-241 REV. E SHEET 1 OF 5 TITLE CROSSTUBE ASS'Y (205/212 HI AFT) SCALE NTS COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

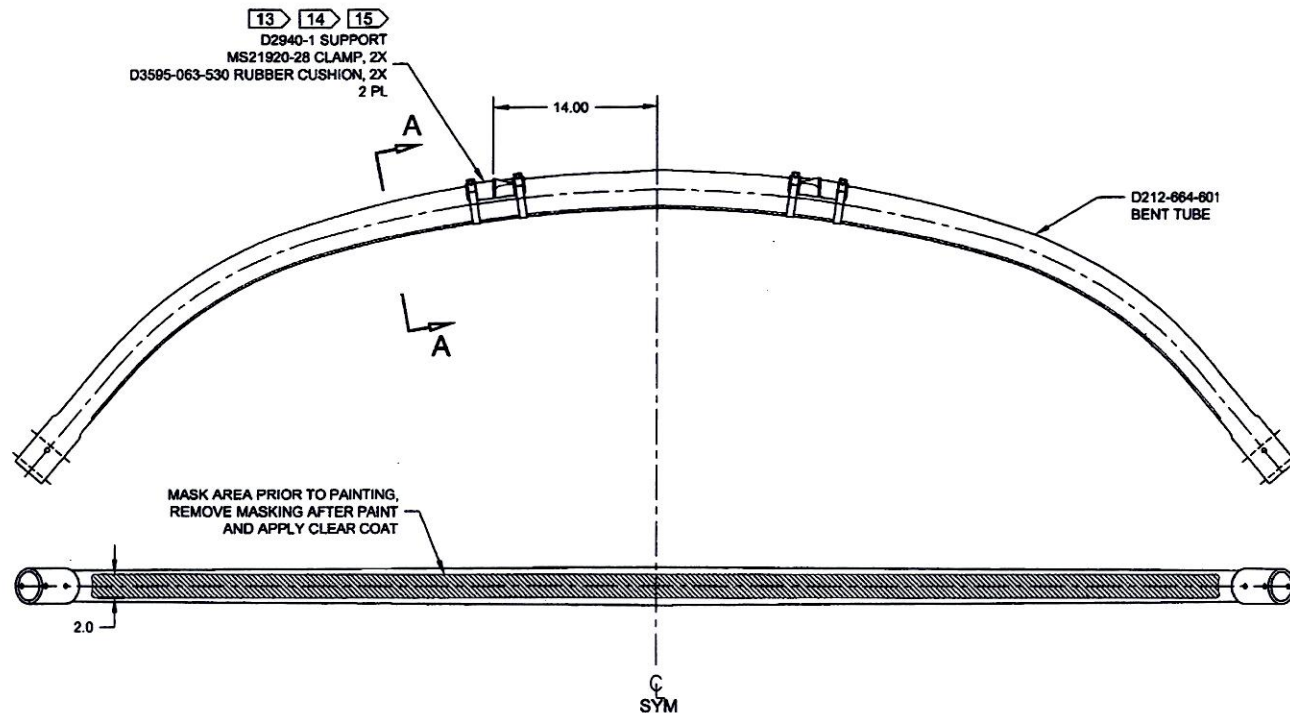

**D212-664-241
ASSEMBLY DETAIL**

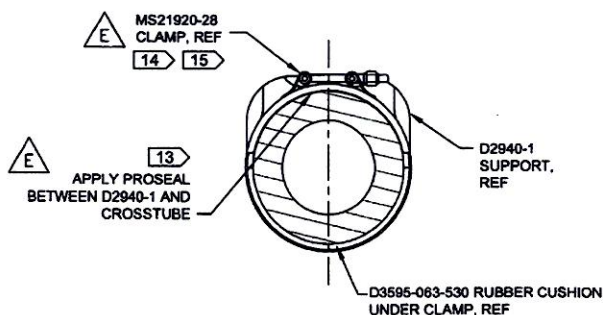


**SECTION A-A
SCALE 4X**

RELEASED
2014-05-26
MD

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-241	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

△ E 13 14 15
D5018-1 SUPPORT
MS21920-28 CLAMP, 2X
D3595-063-530 RUBBER CUSHION, 2X
2 PL

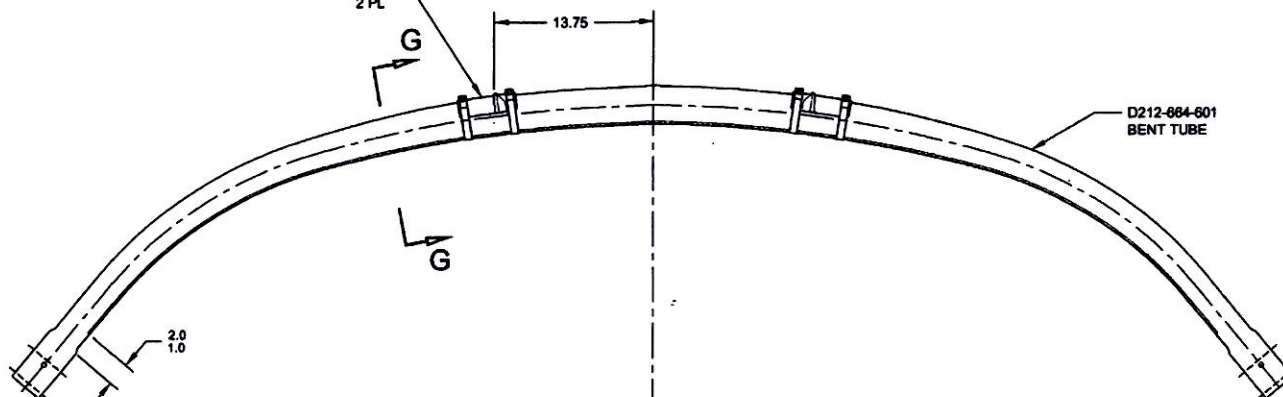

D212-664-601
BENT TUBE

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT




C
SYM

D212-664-241B
ASSEMBLY DETAIL

△ E

△ E MS21920-28
CLAMP, REF
14 15

△ E 13
APPLY PROSEAL
BETWEEN D5018-1 AND
CROSSTUBE

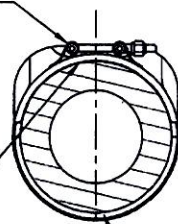

△ E D5018-1
SUPPORT,
REF


D3595-063-530 RUBBER CUSHION
UNDER CLAMP, REF

SECTION G-G
SCALE 4X


RELEASED
2014-05-26

DESIGN	4	DART AEROSPACE LTD	
DRAWN	4	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DL	DRAWING NO.	REV. E
MFG. APPR.	15	D212-664-241	SHEET 3 OF 5
APPROVED	15	TITLE	SCALE
DE APPR.	15	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

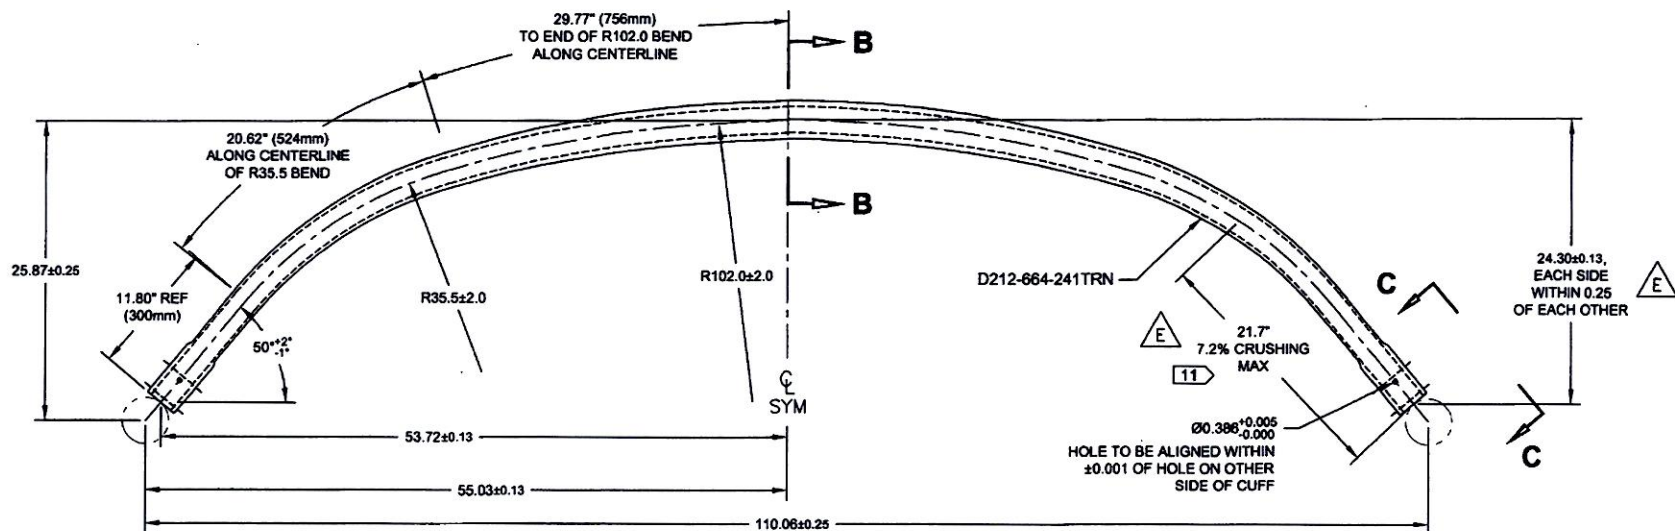

D212-664-601 11
BENDING AND DRILLING DETAIL

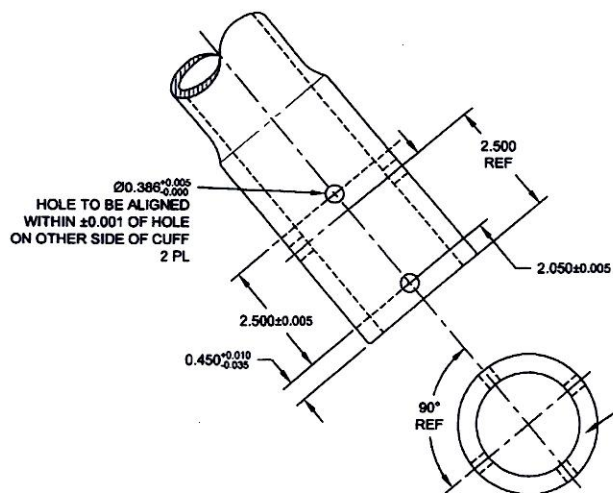

VIEW C-C: CUFF DETAIL
 SCALE 3X

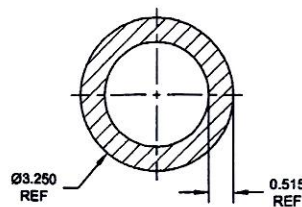

SECTION B-B
 SCALE 4X

RELEASED
 2014-05-26
MP


DESIGN	<i>Q</i>	DART AEROSPACE LTD	
DRAWN	<i>Q</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>Q</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>Q</i>	D212-664-241	SHEET 4 OF 5
APPROVED	<i>Q</i>	TITLE	SCALE
DE APPR.	<i>Q</i>	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS


R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

0.515 WALL
STOCK, REF

SEE DETAIL D

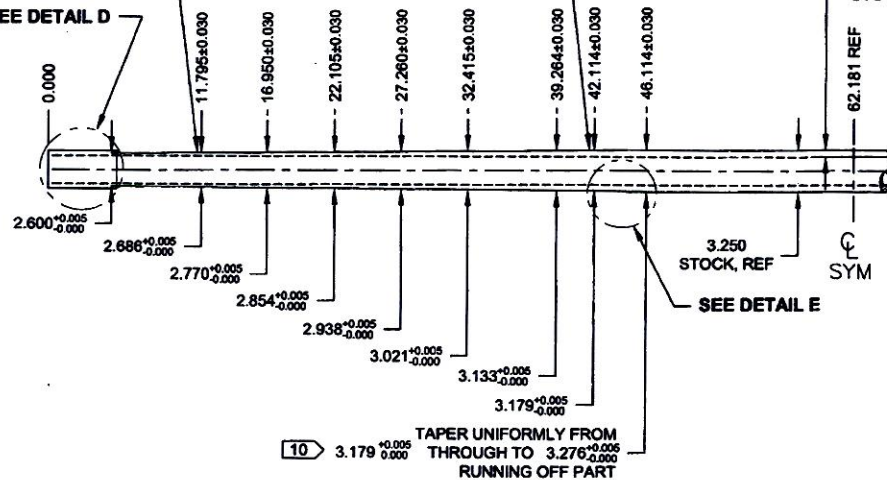


10
30° X 0.500 DEEP
CHAMFER

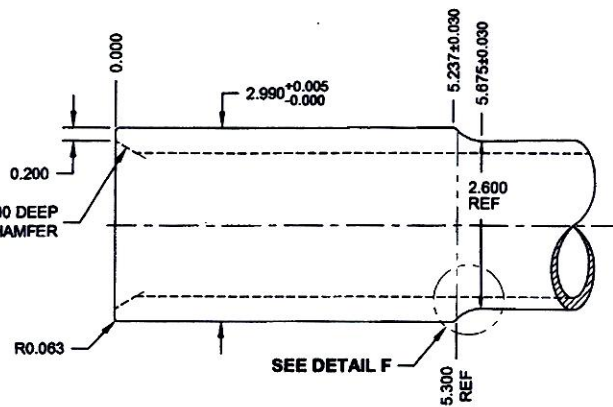


DETAIL D:
CROSSTUBE CUFF
SCALE 5X

D212-664-241TRN
TURNING DETAIL

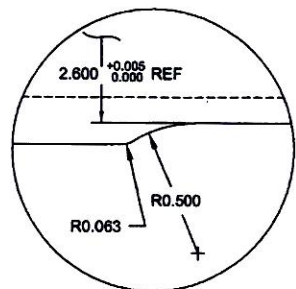

DETAIL F:
CUFF TRANSITION
SCALE 10X

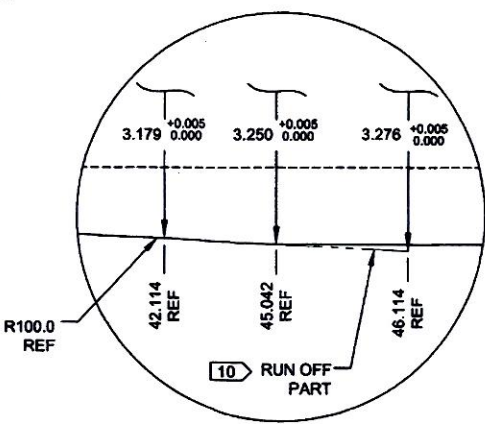

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-241	SHEET 5 OF 5
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR REPRODUCTION IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	